

NUTORK CORP.

NO.158, LANE 1888, DAYE ROAD, FENGXIAN AREA, SHANGHAI, CHINA

The following sample(s) was/were submitted and identified on behalf of the client as:

Sample Description : LIMIT SWITCHBOX
SGS Ref No. : GZIN1512056728MR
Style / Item No. : NTS-CPXX
Sample Receiving Date : Dec. 29, 2015
Test Performing Date : Dec. 29, 2015 to Jan. 7, 2016
Test Performed : Selected test(s) as requested by applicant
Test Result(s) : For further details, please refer to the following page(s)

Signed for and on behalf of
Xiamen Branch, SGS-CSTC Co., Ltd.



Sharky Xia
Approved Signatory



This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755)83071443, or email: CN.Doccheck@sgs.com


No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China 361101 t (86-592) 5766537 f (86-592) 5766460 www.sgs.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编: 361101 t (86-592) 5766537 f (86-592) 5766460 e sgs.china@sgs.com

Summary of Results:

No.	Test Item	Test Method	Result	Conclusion
1	IP6X	IEC 60529:1989+A1:1999+A2:2013 Section 13.4 and Section 13.6	No ingress of dust	/
2	IPX8	IEC 60529:1989+A1:1999+A2:2013 Section 14.2.8	No ingress of water	/

Note: Pass: Meet the requirements;
 Fail: Does not meet the requirements;
 /: Not Apply to the judgment.

Original Sample Photo:

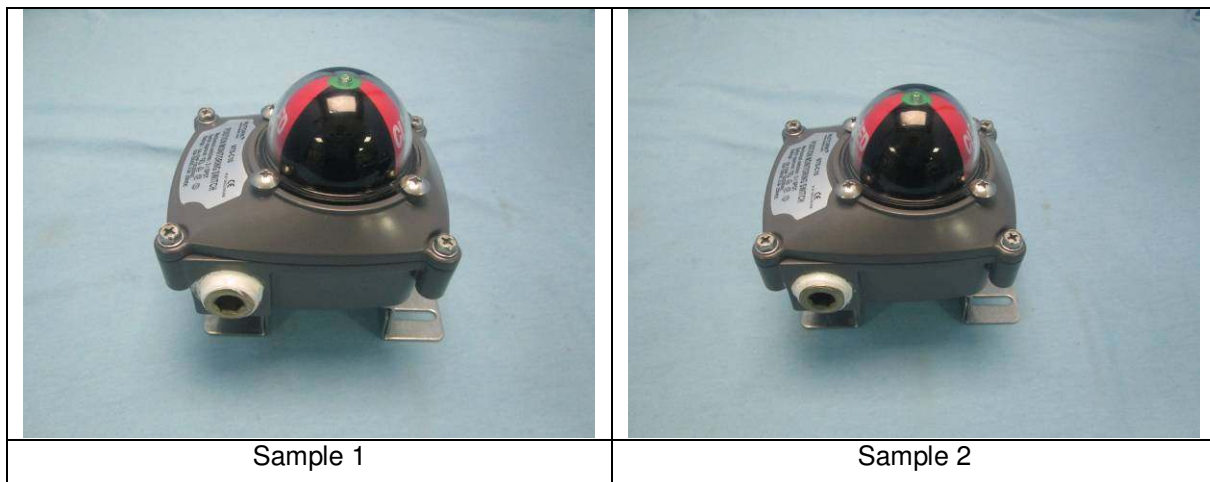

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755)83071443, or email: CN.Doccheck@sgs.com

1. Test Item: IP6X

Sample Description: See photo

Test Method: IEC 60529:1989+A1:1999+A2:2013 Section 13.4 and Section 13.6

Test Condition:

Test Dust: Talcum powder

Dust Concentration: 2 kg/m³ chamber volume and be kept in suspension during the test

Depression: 2 kPa

Test Duration: 8 hours

Lab Environment Condition: 15°C~35°C, 25%RH~75%RH


Test Result:

Sample	Result
1	No ingress of dust

Test Photo:




After test (Sample 1)

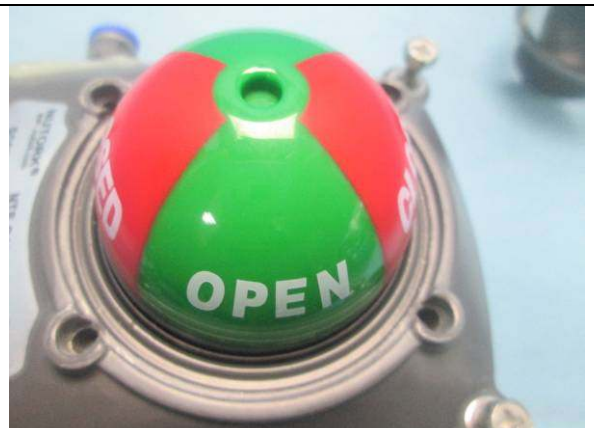

After test (Sample 1) - Local part



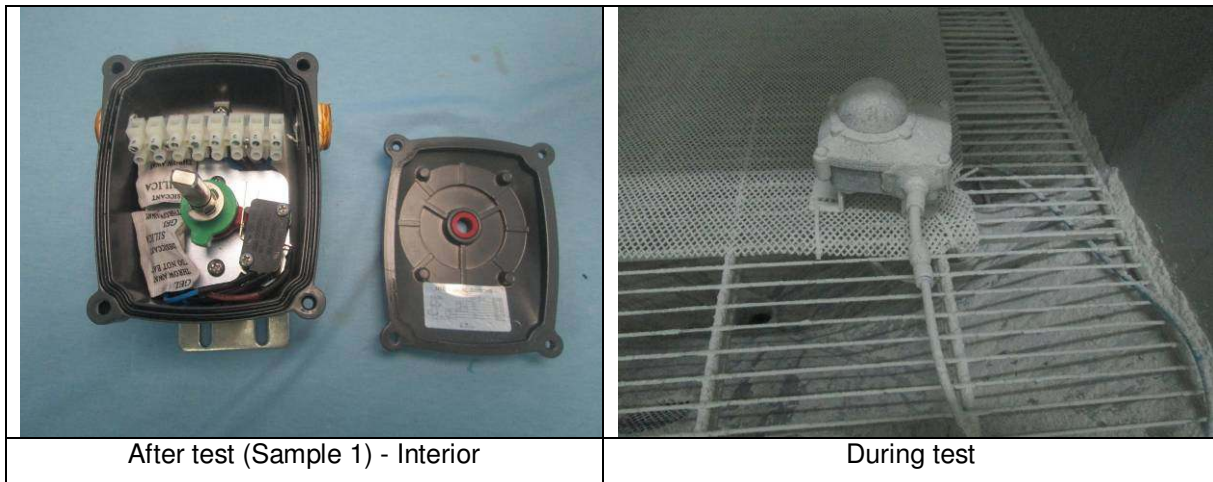

After test (Sample 1) - Interior

During test

Equipment Information:

Equipment	Model	Equipment No.	Calibration date	Next Calibration date
Sand and dust test chamber	SC-010	GZMR-RL-E070	2015-04-14	2016-04-13

2. Test Item: IPX8

Sample Description: See photo

Test Method: IEC 60529:1989+A1:1999+A2:2013 Section 14.2.8

Test Condition:

Depth: 50 m (0.15 m water depth and 0.5 MPa air pressure).


Test duration: 72 H


Test Result:

Sample	Result
2	No ingress of water

Remark: This test was subcontracted to SGS other qualified subcontractor.

Test Photo:

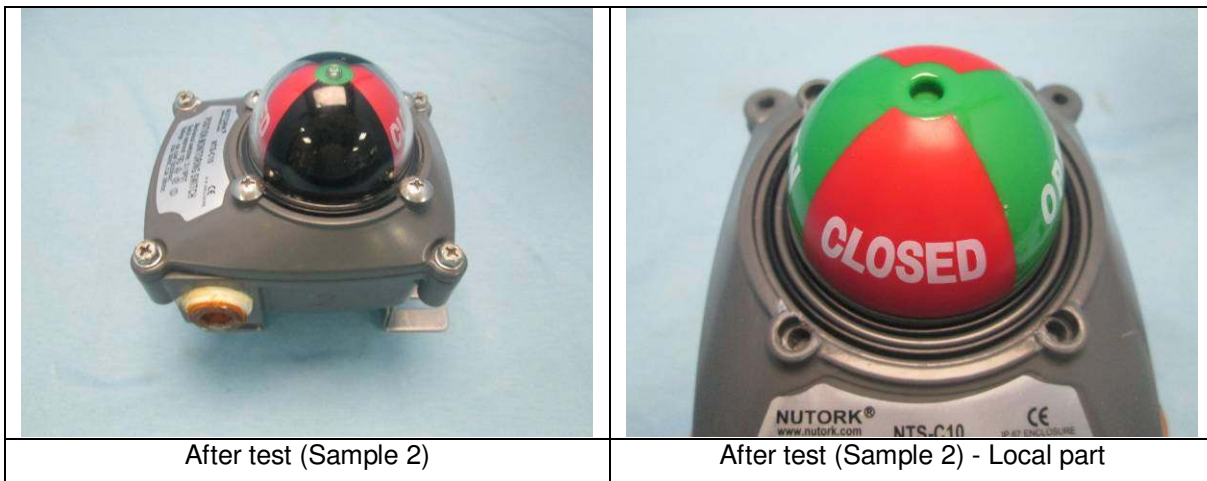

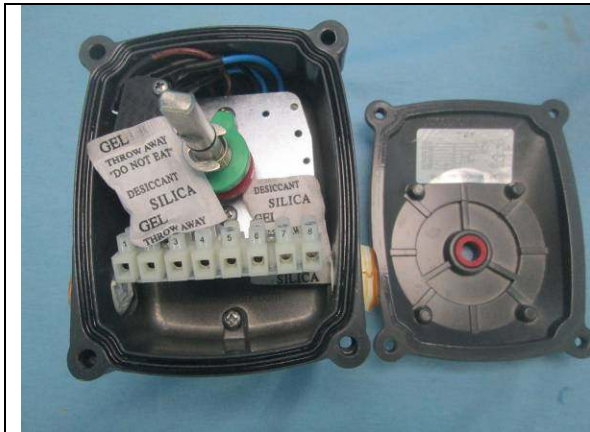

After test (Sample 2) - Interior



During Test



Equipment Information:

Equipment	Model	Equipment No.	Calibration date	Next Calibration date
Waterproof tester	X8	GZMR-RL-E094	2015-08-12	2016-08-11

Remark: This test report is to supersede the test report number XMHG1512007057OT.

The testing report/certificate only refers to the sample(s) tested.

End of Report

